LOC/DME I-CBP	APP CRS	Rwy Idg	8000
109.1	099°	TDZE	815
Chan 28		Apt Elev	815

ILS or LOC RWY 10L

COLUMBUS/PORT COLUMBUS INTL (CMH)

▼ ADF or RADAR required.
▲ Simultaneous approach authorized with Rwy 10R.
**RVR 1800 authorized with the use of FD or AP or HUD to DA.

MALSR

MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct APE VORTAC and hold.

ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON	CLNC DEL	UNICOM
124.6	125.95 371.975	132.7 257.8	121.9 348.6	126.3	122.95

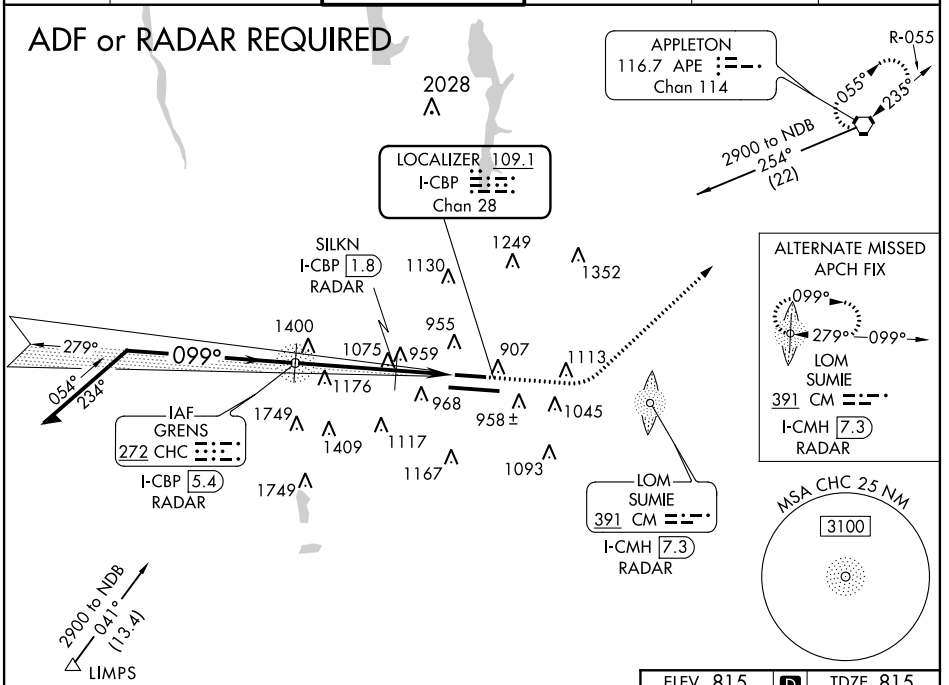

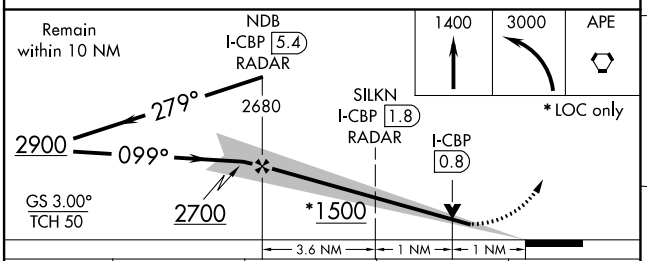

CATEGORY	A	B	C	D
S-ILS 10L		**1015/24 200 (200-½)		
S-LOC 10L	1500/24 685 (700-½)		1500-1½ 685 (700-1½)	1500-1¾ 685 (700-1¾)
CIRCLING	1500-1 685 (700-1)		1500-2 685 (700-2)	1500-2¼ 685 (700-2¼)
SILKN FIX MINIMUMS				
S-LOC 10L	1180/24 365 (400-½)			1180/40 365 (400-¾)
CIRCLING	1340-1 525 (600-1)		1340-1½ 525 (600-1½)	1380-2 565 (600-2)

ELEV 815 D TDZE 815

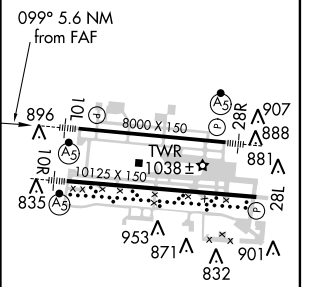

HIRL Rwys 10R-28L and 10L-28R

FAF to MAP 5.6 NM

Knots	60	90	120	150	180
Min:Sec	5:36	3:44	2:48	2:14	1:52

EC-2, 07 FEB 2013 to 07 MAR 2013

EC-2, 07 FEB 2013 to 07 MAR 2013