LOC I-ELP	APP CRS	Rwy Idg	12020
111.5	219°	TDZE	3949
Chan 52		Apt Elev	3959

ILS or LOC RWY 22

EL PASO INTL (ELP)

ASR

Cat E circling not authorized west of airport. Procedure turn not authorized for Cat E aircraft. For inoperative MALSR increase S-ILS 22 Cat E visibility to RVR 4000 and S-LOC 22 Cat E visibility to RVR 6000. **Visibility Cat A/B/C/D RVR 1800 authorized with the use of FD or AP or HUD to DA.

MALSR

MISSED APPROACH: Climb to 4600, then climbing left turn to 7300 direct ELP VORTAC and hold. (TACAN equiped aircraft continue climbing to 9000 via ELP R-058 to WHOLE Int/ ELP 22.7 DME)

ATIS	EL PASO APP CON	EL PASO TOWER	GND CON	CLNC DEL
120.0 254.3	124.25 298.85	118.3 239.275	121.9 348.6	125.0 379.1

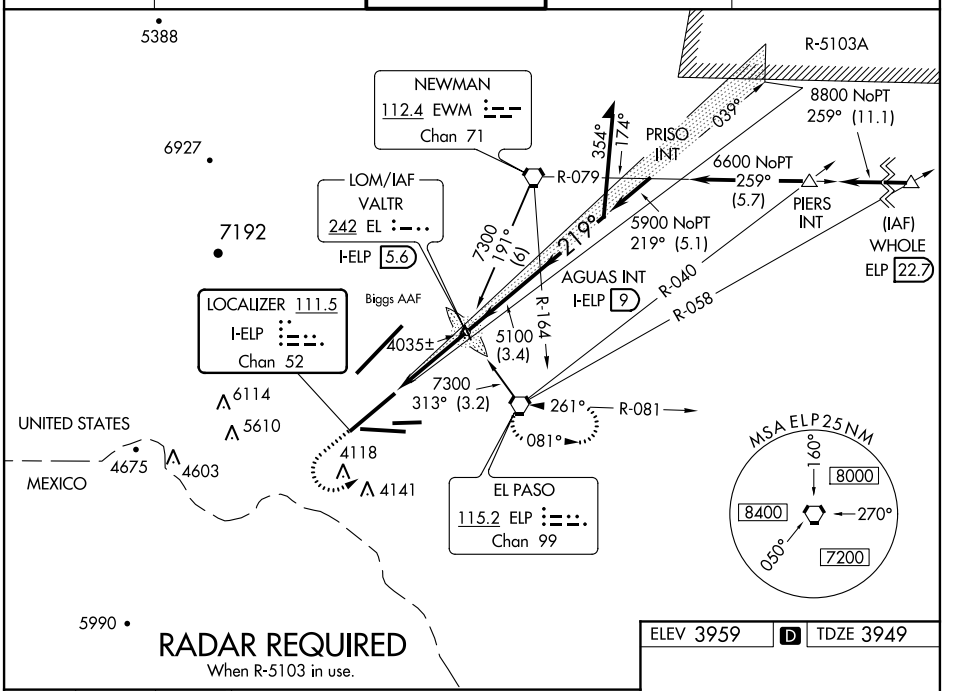



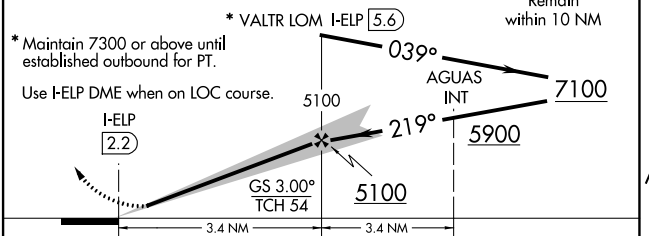

CATEGORY	A	B	C	D	E
S-ILS R22	**4149/24 200 (200-½)				
S-LOC R22	4300/24 351 (400-½)			4300/40 351 (400-¾)	
CIRCLING*	4420-1 462 (500-1)		4420-1½ 462 (500-1½)	4520-2 562 (600-2)	4660-2½ 702 (800-2½)

ELEV 3959 D TDZE 3949

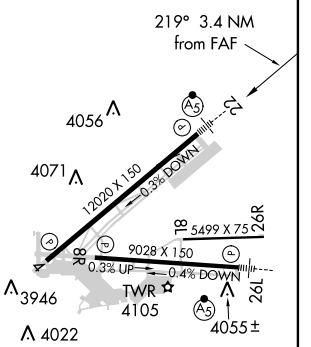

MIRL Rwy 8L-26R
REIL Rwys 4 and 8R
HIRL Rwys 4-22 and 8R-26L

SC-3, 07 FEB 2013 to 07 MAR 2013
SC-3, 07 FEB 2013 to 07 MAR 2013