APP CRS	Rwy Idg	10506
272°	TDZE	8
	Apt Elev	8

RNAV (RNP) Y RWY 26L

MIAMI INTL (MIA)

GPS Required. For inoperative MALSF, increase RNP 0.20 all Cats visibility to RVR 6000, RNP 0.30 all Cats visibility to 2. For uncompensated Baro-VNAV systems, procedure NA below 6°C (42°F) or above 48°C (119°F).

NA

MALSF

MISSED APPROACH: Climb to 2000 direct LAWNN and via 345° track to BRBRA and hold.

ATIS	MIAMI APP CON	MIAMI TOWER	GND CON	CLNC DEL
119.15	124.85 322.3	118.3 256.9	121.8 (8L/8R/12/26L/26R) 127.5 (9/27/30) 348.6	135.35

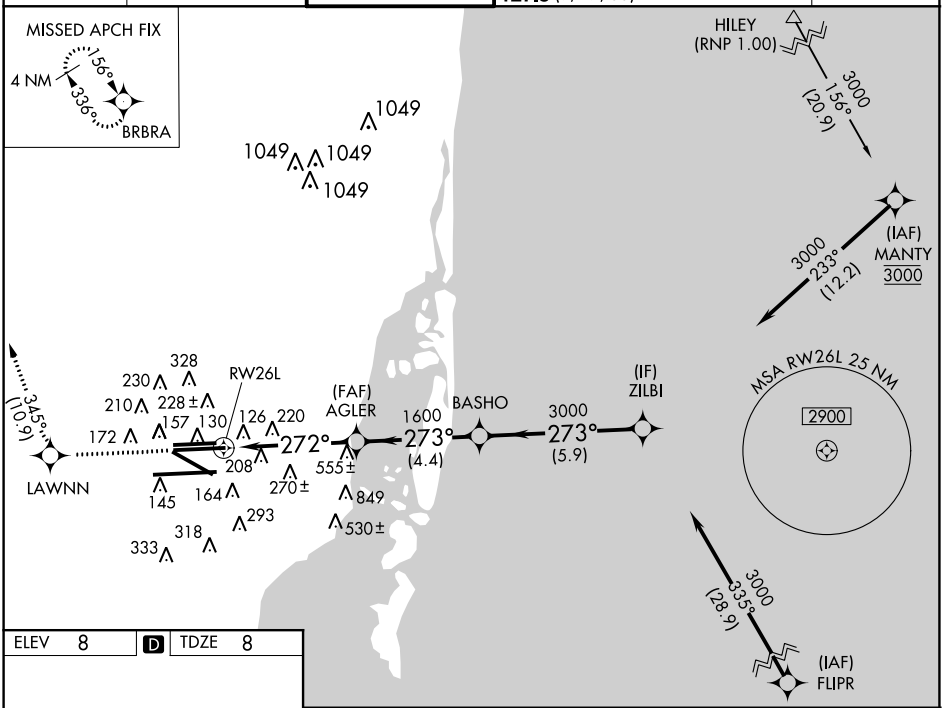

SE-3, 07 FEB 2013 to 07 MAR 2013

SE-3, 07 FEB 2013 to 07 MAR 2013

ELEV 8 D TDZE 8

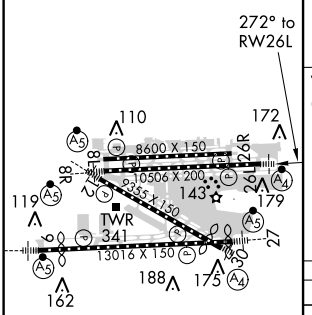

TDZ/CL Rwy 8R
REIL Rwys 8L and 26R
HIRL all Rwys

2000	LAWNN	345° tr	BRBRA

Procedure Turn NA

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 73).

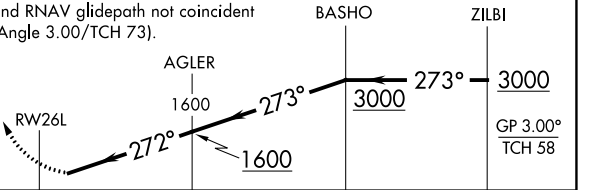

CATEGORY	A	B	C	D
RNP 0.20 DA	407/50 399 (400-1)			
RNP 0.30 DA	564-1¾ 556 (600-1¾)			

AUTHORIZATION REQUIRED