

WAAS CH 99603 W10A	APP CRS 099°	Rwy Idg TDZE 810 Apt Elev 815	10125
--	------------------------	---	--------------


RNAV (GPS) Y RWY 10R

COLUMBUS/PORT COLUMBUS INTL (CMH)

▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C (4°F) or above 47°C (116°F). DME/DME RNP-0.3 NA. Simultaneous approach authorized with ILS or LOC Rwy 10L. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations.


MISSED APPROACH: Climb to 3000 direct CORED and hold.

ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3
----------------------	---	--------------------------------------	-------------------------------	--------------------------

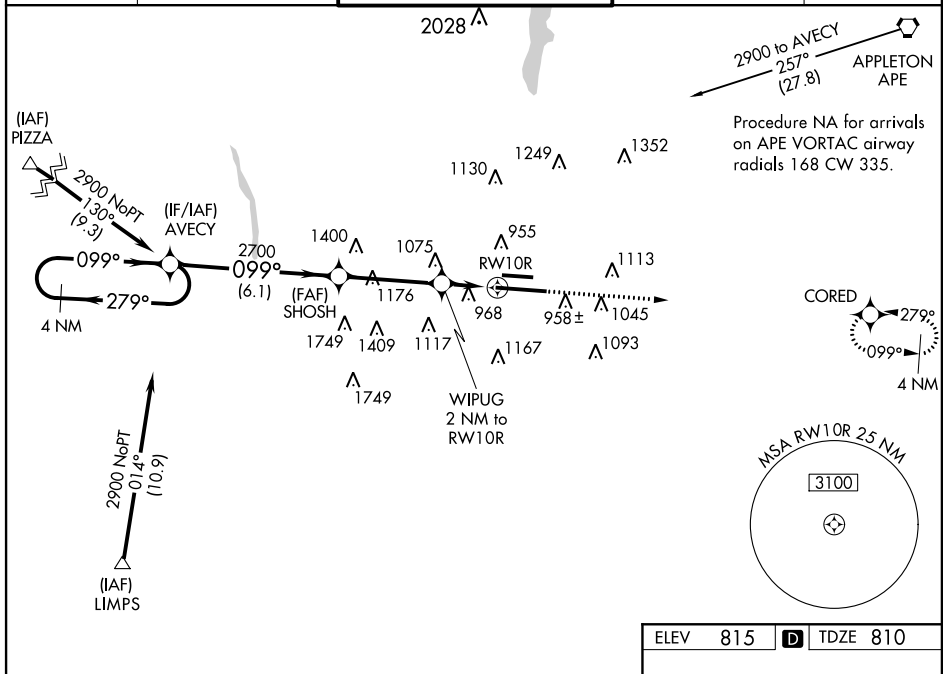

EC-2, 07 FEB 2013 to 07 MAR 2013

EC-2, 07 FEB 2013 to 07 MAR 2013

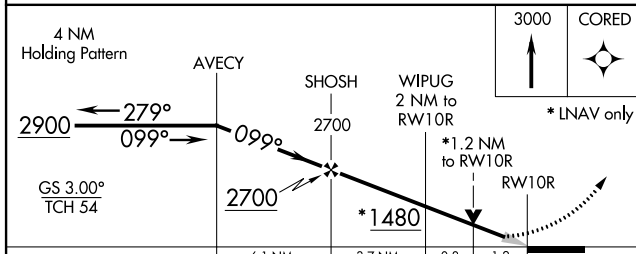

CATEGORY	A	B	C	D
LPV DA		1010/24	200 (200-½)	
LNAV/VNAV DA		1268/50	458 (500-1)	
LNAV MDA	1240/24	430 (500-½)	1240/40 430 (500-¾)	1240/50 430 (500-1)
CIRCLING	1340-1	525 (600-1)	1340-1½ 525 (600-1½)	1380-2 565 (600-2)

