


WAAS CH 48999 W28A	APP CRS 279°	Rwy Idg TDZE Apt Elev	10125 814 815
--	------------------------	-----------------------------	--

RNAV (GPS) Y RWY 28L

COLUMBUS/PORT COLUMBUS INTL (CMH)

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -1.6°C (4°F) or above 47°C (116°F). DME/DME RNP-0.3 NA.	MALS 	MISSED APPROACH: Climb to 2900 direct AVECY and hold.
---	----------	---



ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3
----------------------	---	--------------------------------------	-------------------------------	--------------------------

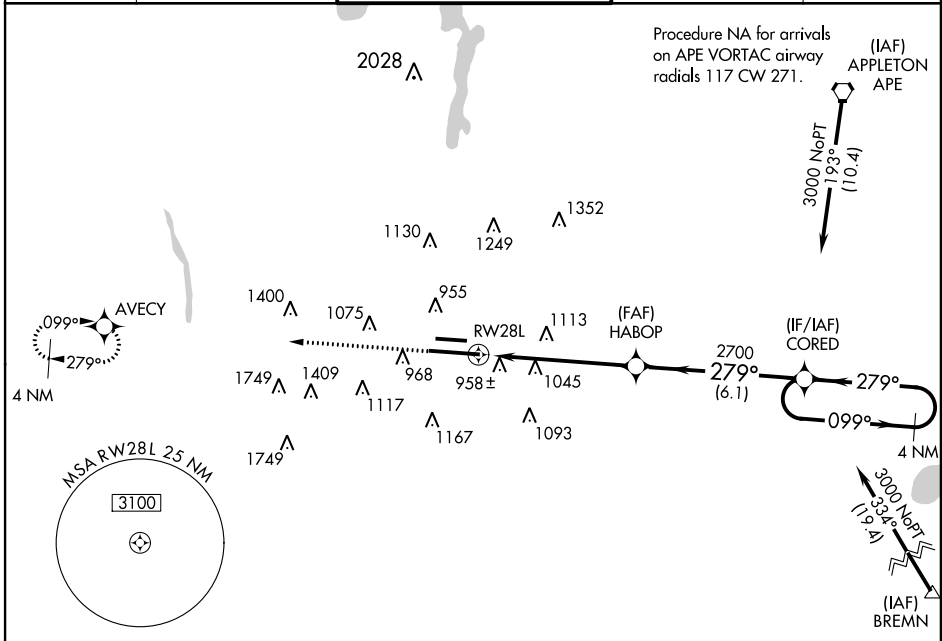

EC-2, 07 FEB 2013 to 07 MAR 2013

EC-2, 07 FEB 2013 to 07 MAR 2013

ELEV 815	D	TDZE 814
----------	----------	----------

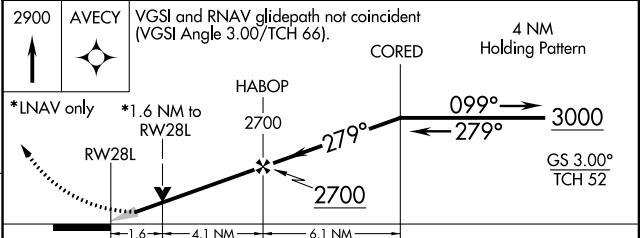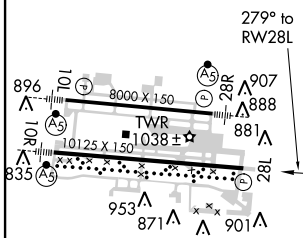

LPV DA	1014/24	200 (200-½)		
LNAV/VNAV DA	1341/60	527 (600-1¼)		
LNAV MDA	1380/24	566 (600-½)		
CIRCLING	1380-1	565 (600-1)	1380-1½ 565 (600-1½)	1380-2 565 (600-2)