


LOC I-ATD 108.9	APP CRS 061°	Rwy Idg 10900 TDZE 998 Apt Elev 1009
---------------------------	------------------------	---

ILS RWY 6L (CAT II)
DAYTON/JAMES M. COX DAYTON INTL (DAY)

ASR Simultaneous approach authorized with Rwy 6R.	ALSF-2 	MISSED APPROACH: Climb to 2000 then climbing left turn to 3000 direct DQN VOR/DME and hold.
--	------------	---


ATIS 125.8	COLUMBUS APP CON 118.425 323.15	DAYTON TOWER 119.9 257.7	GND CON 121.9	CINC DEL 121.75
----------------------	---	------------------------------------	-------------------------	---------------------------

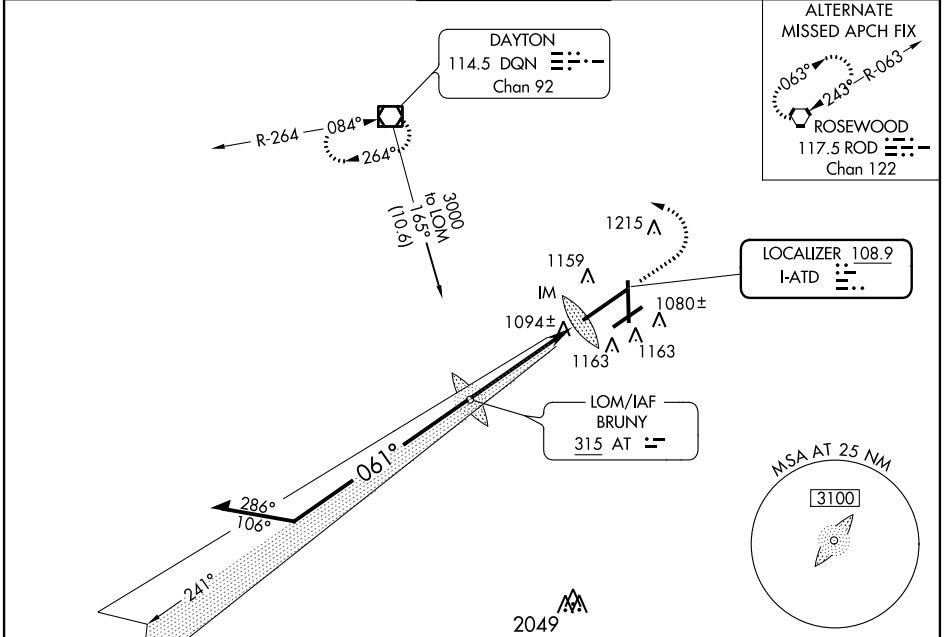


EC-2, 07 FEB 2013 to 07 MAR 2013

EC-2, 07 FEB 2013 to 07 MAR 2013

ADF or RADAR REQUIRED

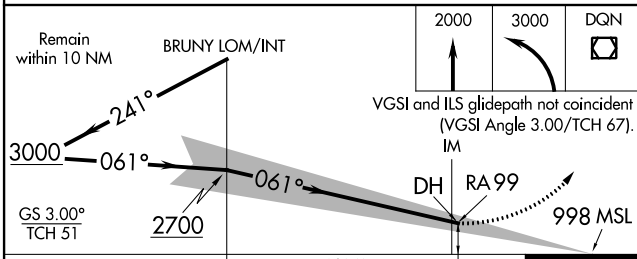

ELEV 1009	D	TDZE 998
-----------	----------	----------

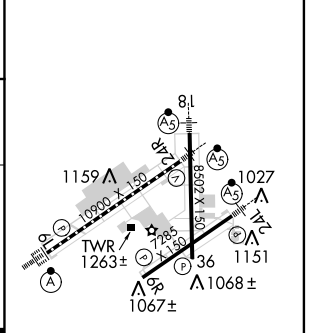

CATEGORY	A	B	C	D
S-ILS 6L		RA 99/12	100 DA 1098	

CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

HIRL all Rwys
TDZ/CL Rwy 6L
REIL Rwys 6R and 36