

TACAN NFL Chan 82	APCH CRS 297°	Rwy Idg TDZE Arpt Elev	31L 14,005 31L 3926 31R 3928 31R 3928	31R 11,080 31R 3928
----------------------	------------------	------------------------------	--	------------------------


JAL-143 [USN] FALLON NAS (VAN VOORHIS FLD) (KNFL)

<p>▼</p> <p>* MISSED APPROACH: Climb direct NFL TACAN, then climbing right turn to 9000. Intercept NFL R-022 outbound to PILOW and hold.</p>		<p>GND CON 251.15</p>		<p>CLNC DEL 353.55</p>		<p>ASR/PAR</p>
<p>ATIS ★ 370.925</p>	<p>NAVY FALLON APP CON 120.85 360.2</p>		<p>NAVY FALLON TOWER ★ 119.25 340.2</p>			

* CAUTION: Missed Approach Minimum
Climb Rate to 9000



Knots	120	180	240	300	360
V/V(fpm)	440	660	880	1100	1320

ATC Minimum Climb Rate

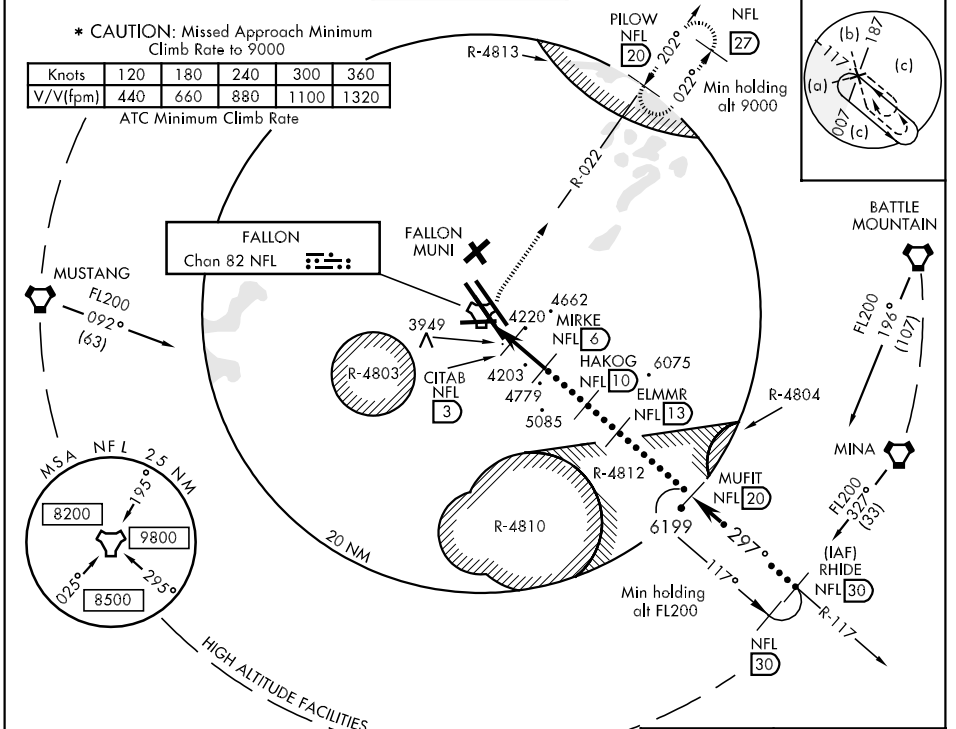

EMERG SAFE ALT 100 NM 15,600

ELEV 3934

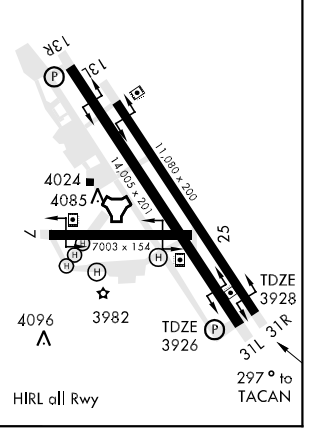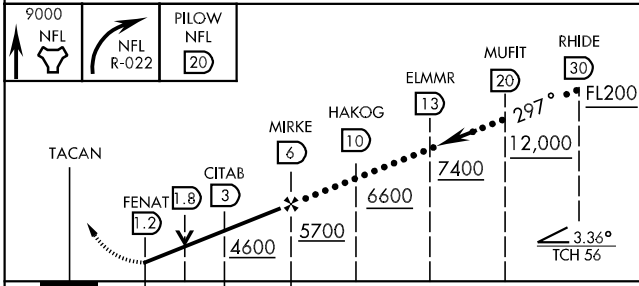

CATEGORY	C	D	E
S-31L	4200-1	274	(300-1)
S-31R	4200-1	272	(300-1)
CIRCLING	4400-1½	4520-2	4980-3
	466 (500-1½)	586 (600-2)	1046 (1100-3)

SW-4, 07 FEB 2013 to 07 MAR 2013

SW-4, 07 FEB 2013 to 07 MAR 2013